

Confidential

TECHNICAL SERVICE BULLETIN

NO. 1-C-1



TRIUMPH

DATE: January 28, 1969

BRITISH LEYLAND MOTORS INC.
600 Willow Tree Road • Leonia • New Jersey 07605

SUBJECT:

Door Glasses

MODELS:

All Models

Door glasses pulling out of the regulator channel is due to a clash of tolerances between the thickness of the glazing strip and the width of the regulator channel together with the fitting of the polythene curtain between glass and glazing rubber where specified.

When refitting the glass, slightly squeeze the regulator channel, renew glazing rubber and on cars so specified fit the polythene curtain between glazing rubber and the regulator channel. This latter operation is most important.

JP/bs