

Confidential

TECHNICAL SERVICE BULLETIN

1-C-6

NO.

BRITISH



LEYLAND

TRIUMPH

DATE: May 1970

BRITISH LEYLAND MOTORS INC.

600 Willow Tree Road • Leonia • New Jersey 07605

SUBJECT: REAR REFLEX REFLECTOR CAMPAIGN
Campaign Number CCL693

MODELS:
TR-6

Serial Numbers Affected:
CC 50958 to CC 52453


It has been determined that the rear reflex reflector lens on a limited number of TR-6 vehicles manufactured during January and February, 1970, does not meet class "A" requirements. The affected range of cars are being recalled to have additional reflectors fitted.

The attached drawing shows the correct location of these additional reflectors (2 per car), which are available from your distributor upon ordering.

Two of Part Number 155750 - Reflex
Two of Part Number 629623 - Plinth
Two of Part Number YZ3305 - Screw
Two of Part Number YZ3310 - Screw

A warranty time of 0.50 hours per car will be allowed. Please insure that the campaign number - CCL693 - appears in the appropriate space on the claim form.

A copy of an invitation to all owners of cars within the serial numbers affected appears on the reverse side of this bulletin.

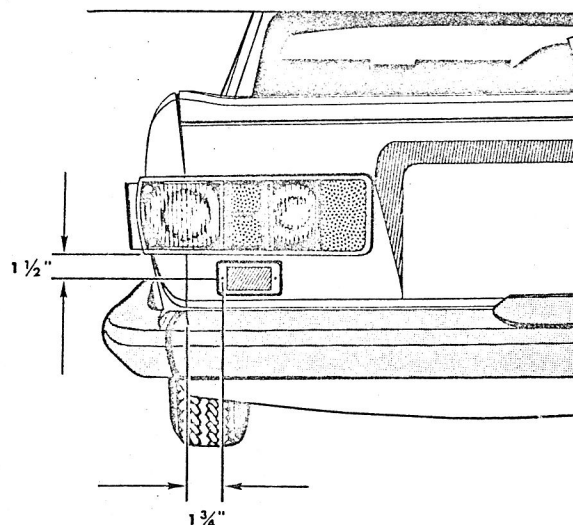

Dear Triumph Owner:

Under the requirements of the National Traffic and Motor Vehicle Safety Act of 1966 (Public Law 89-563), we wish to advise you of a recall affecting your Triumph TR-6.

The recall involves a simple installation by your dealer, at no charge to you, of two rear reflex reflector assemblies. These reflectors are fitted on the rear of the vehicle between the bumper and the rear lamp assembly.

The rear lamp fitted to your TR-6 was designed to meet the current Motor Vehicle Safety Standards and incorporates a reflex reflector. Subsequent routine optical testing carried out on behalf of our supplier, has shown that some lamps may not meet the Safety Standards in effect on January 1, 1970. We are, therefore, asking your cooperation to make your vehicle available for the installation of these reflectors, thereby insuring that your vehicle is in compliance with the government's regulations.

TR6 REAR REFLEX REFLECTORS

On all TR6 vehicles manufactured after January 1, 1970, two additional rear reflex reflectors must be fitted as illustrated below.

A number of vehicles have been released from the factory which were not fitted with these reflectors and vehicles between the following serial numbers must have the reflectors fitted in the field -

CC50958 - CC52453.

The reflectors must be installed in accordance with the dimensions given in the illustration and drilling template below. The wedge-shaped rubber plinth should be fitted between the reflector and the body so that the reflector lies in a vertical plane.

PARTS REQUIRED:-

	TRIUMPH PART #	QUANTITY
Rear Reflex Reflector -	11570 (Lucas #575908)	- 2 per vehicle
Plinth for Reflector -	88629623 -	- 2 "
	(Lucas #54582060)	
Self-tapping Screw -	1 1/4" x No. 6 pan head	- 4 "

TEMPLATE

ALIGN WITH LOWER
EDGE OF REAR LAMP FOR L.H. SIDE

ALIGN WITH POINT
LINE OF REAR FENDER

ALIGN WITH LOWER EDGE OF
REAR LAMP FOR R.H. SIDE

