


TECHNICAL SERVICE BULLETIN

1-D-8

NO.

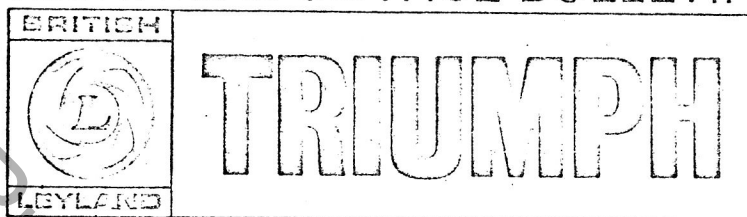

June 1970

SUBJECT:

Gearbox Selector Rail
Modification

MODELS:

Spitfire, GT-6 Plus

At gearbox number FD 55620 and KC 23959, the position of the reverse light switch relative to the selector rail centerline was raised to reduce machining on the reverse rail.

Interchangeability of the top cover as an assembly is not affected, but the reverse selector shaft as a component is not interchangeable owing to a change in the shaft depth for the reverse light plunger.

The latest selector shaft can be fitted to early covers using additional washers under the reverse light switch.

The early type selector shaft in a later cover will not operate the switch.

PART NUMBERS AFFECTED

SPITFIRE

516080
134290

Top Cover Assembly
Selector Shaft - Reverse

replaced by

518606
154944

Top Cover Assembly
Selector Shaft - Reverse

GT-6 Plus

516099
147775

Top Cover Assembly
Top Cover Sub-assembly

replaced by

518605
154953
154945

Top Cover Assembly
Top Cover Sub-assembly
Selector Shaft - Reverse