

TECHNICAL SERVICE BULLETIN

NO.

71-B-5



TRIUMPH

SUBJECT:

Alternators

MODELS:

All Models

Some alternator failures are associated with loose connections at the main terminal, due to the plug not being pushed home firmly. This condition causes arcing at the terminals, resulting in the plug (and Lucas inserts) losing retention ability.

Should this condition occur, then the plug should be replaced, otherwise subsequent alternator failure will occur.

The part number of this Plug Kit is 520109, (Lucas part number 54219410).