



TO: All Dealers

BULLETIN #T-61-12

DEPT: Service

DATE: May 12, 1961

SUBJECT: ELECTRIC HORNS - TRIUMPH HERALD

A number of cases of unnecessary replacement of the electric horns fitted to the Triumph Herald have come about, possibly due to the fact that those concerned are not aware of the correct method of adjusting this instrument.

The electric horn fitted to the Triumph Herald manufactured by "Clear Hooters" is of sturdy construction and it will usually be found that failure to operate is due to an adjustment being required to the contact points by means of the one and only visible screw on the back of the instrument. The screw should be moved in whichever direction may be required quite slowly so that the critical position is not missed.

When making the adjustment it is advisable to press the horn button intermittently rather than keeping it firmly pressed all the time in order to avoid undue heating of the coils.

The above adjustments are suggested on the assumption that an electrical continuity test will have been previously made with the contact adjusting screw slackened back a few turns to ensure closure of the contact points.


Zone Service Manager

W. T. Yeager
dm