



TO: All Dealers

BULLETIN ST-61-16

DEPT: Service and Parts

DATE: May 29, 1961

SUBJECT: GEAR LEVER RATTLE - RERATED

The following modifications have been incorporated to prevent "rattle" from the gear change mechanism:

1. The metal dished inner washer Part No. 121727 fitted under the top cover extension cap has been replaced by a nylon washer Part No. 128373.
2. A new gear lever and operating shaft, incorporating two nylon bushes and a pinch sleeve in the end of the lever, has been introduced. The part numbers of the new details are:

Gear Lever	-	129121	-	(Original lever 121487)
Nylon bush	-	129118	-	(Original bush 116839)
Operating				
Shaft Assy.	-	129952	-	(Original shaft 119260)
1 Pinch Sleeve	-	129119		

Most complaints of rattle from the gear change mechanism may be successfully dealt with by fitting the nylon washer only.

Obstinate cases will require all of the new details listed above, these being obtainable from our Parts Department in the normal manner.

W. T. Yeager
Zone Service Manager

W. T. Yeager
dm