



TO: All Dealers

BULLETIN: T-61-28

DEPT: Service and Parts

DATE: November 6, 1961

SUBJECT: HERALD FRONT SUSPENSION

To improve the sealing and prevent premature wear of the bushes of the front suspension lower trunnion, shims have been added to the assembly as shown in the illustration.

When the occasion arises to renew the trunnion bushes these shims should be added, which necessitate replacement of the distance piece Part No. 132039 in place of the original distance piece Part No. 122497. The fitting instructions are as follows:

1. Remove hex. nut YN2910 and washer WP0010. Withdraw hex. bolt HB1020.
2. Remove distance piece 122497, bearing 122496 and seals 122534 from lower trunnions.
3. Reassemble above items as follows:

Fit shims 132038 between bearings 122496 and lower trunnions as shown in modified assy.

4. Fit distance piece 132039 in place of 122497. Fit seals 122534.
5. Reassemble and insert hex. bolt HB1020.
6. Replace washer WP0010 and hex. nut YN2910.

This modification was incorporated on production at the following Commission Numbers:

GA-17863-DL
GA-17902-LCP

GA-17866-LCV
G-66121-SP

GA-17876-SC

NOTE: These instructions are for information only and do not constitute an authority to carry out modifications at the expense of the Standard-Triumph Motor Company, Inc.


Zone Service Manager

W. T. Yeager
dm

TRUNNION

YN2910

122534

HB1020

WR0010

122496

122497

132038

132039

MODIFIED ASSEMBLY.