



TO: All Dealers

BULLETIN #T-61-9

DEPT: Service and Parts

DATE: May 12, 1961

SUBJECT: CRACKING OF T.R.3 WINDSCREEN

Cases have been reported of repeated cracking of T.R.3 windshields.

A protection against the possibility of this occurrence is to slacken the side stanchion bolts sufficiently to permit the windshield frame to align itself when the soft top is placed in position and then re-tighten the stanchion bolts in that position.

This procedure assists in taking care of any discrepancies in the tension between the two sides of the windshield frame.

Further, in replacing broken glass special care should be taken not to spread or distort the frame in any way while removing broken glass and to be certain that the new glass is perfectly centered in the frame.

W. T. Yeager
dm


Zone Service Manager