

STANDARD-TRIUMPH MOTOR COMPANY, INC.

NORTHEASTERN ZONE



TO: All Dealers

BULLETIN: 62-62-12

DEPT: Service and Parts

DATE: April 25, 1962

SUBJECT: TR-4 UNDERSIDE BODY PANEL

A few cases have been reported of a loud metallic noise being apparent when the car body flexes under normal road movements. Where this condition arises it will usually be found caused by a portion of the underside lip of the body panel touching the rear shock absorber bracket.

The condition is readily corrected by peeling the body panel lip at the appropriate point to give clearance. This modification has been incorporated on all TR-4 models from serial number 01-4500.

W. T. Yeager
Zone Service Manager

W. T. Yeager

dr