



TO: ALL TRIUMPH DEALERS - WESTERN ZONE

DEPT: SERVICE AND PARTS

BULLETIN T-63-59A

SUBJECT: TRIUMPH HERALD, TRIUMPH 1200  
AND SPITFIRE GENERATOR  
REINFORCING BRACKET

DATE: SEPTEMBER 6, 1963

Should a failure of the generator mounting bracket occur on any of the above models, the bracket should be replaced by the following details which include an additional reinforcing bracket.

|                               |        |       |
|-------------------------------|--------|-------|
| Generator mounting bracket    | 104890 | 1 off |
| Generator reinforcing bracket | 137622 | 1 off |
| Generator bolt                | HB0810 | 1 off |
| Generator bolt nut            | HN2008 | 1 off |

The diagram shown below illustrates the location of the additional reinforcing bracket.

The reinforced bracket was introduced on production at the following engine numbers: GA-117163-E, GC-9042-E and FC-12035-E.

