

LEYLAND-TRIUMPH SALES COMPANY, INC.

WESTERN ZONE



TO: ALL TRIUMPH DEALERS - WESTERN ZONE

DEPT: SERVICE DEPARTMENT

BULLETIN T-66-43

SUBJECT: WATER HOSES

DATE: AUGUST 25, 1966

This bulletin is to advise you of the possibility of the incorrect fitting of the bottom hoses, part number 108422 and 130038 onto the steel pipe, part number 130039. It is a simple matter to check by feel whether or not this condition exists on TR-4A approximate serial numbers CT or CTC 65000 to 70000.

In some cases the pipe is only into the hose connections by about 1/4 of an inch leaving the clip holding with only one half.

The correction is to slacken off hose clips and make sure that the steel pipe is fitted further one inch into the hose and then the clips retightened.

Therefore, it is recommended at periodical checks that this is inspected by your service department.