



TO: ALL TRIUMPH DEALERS - WESTERN ZONE

DEPT: SERVICE DEPARTMENT

BULLETIN T-66-50

SUBJECT: GEAR LEVER RATTLE
TRIUMPH 2000

DATE: OCTOBER 21, 1966

The following procedure should be adopted to deal with complaints of gear lever rattle on the Triumph 2000.

- a. Remove gear lever grommet, gear lever cap and spring retainer and replace existing spring with a stronger spring, part number 145796.
- b. Reassemble parts, excepting grommet.
- c. Place the gear lever into the 1st and 2nd gate position and screw in locating pin in a clockwise direction until contact is made with the bush moulded into the lever. (contact is apparent when slight movement of the gear lever takes place). Unscrew half a turn to give working clearance and lock the nut.
- d. Move the gear lever into the reverse position and repeat similar operation with the other locating pin.

A stronger spring will be available from our Spares Division.