

BRITISH LEYLAND MOTORS INC.

600 WILLOW TREE ROAD • LEONIA, NEW JERSEY 07605 • Tel: (201) 461-7300 • Telex No.: 135491

Dear Triumph Owner:

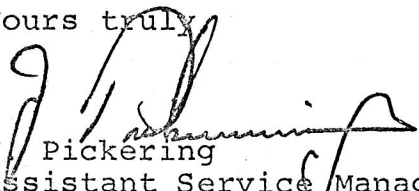
This is to advise you that improper use of the seat slide operating lever can cause it to break off, with the result that the seats are not secured properly from sliding back and forth in the seat slides.

The seat slide operating lever is designed to operate horizontally, but it seems that there are some cases where the operators have attempted to operate the lever by pulling it upward, in which case, of course, it could break off with the effect described above and, under certain circumstances, constitute a safety hazard if the car is continued to be operated in this condition.

No problems exist where the lever has been properly used, but as an additional safeguard or to take care of any cases that have been broken by misuse, a replacement kit of parts will be fitted to your Triumph on a no-charge basis upon application to your Triumph dealer.

Attached to this letter is a copy of a Service Bulletin which has been circulated to all Triumph dealers, and we trust that you will avail yourself of this offer.

Yours truly


J. Pickering
Assistant Service Manager

JP:mm
Attachment

Method of Replacement

1. Remove both seat assembly with slide from car.
2. Remove loading spring of seat slide operating lever.
3. Remove securing rivets from operating lever.
4. Fit the new strengthened type operating lever with longer rivets and new retaining clips.
5. Refit loading spring to lever.
6. Refit seat to car.

A copy of an invitation to all owners of cars within the serial numbers concerned is attached.

